

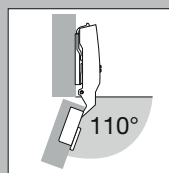
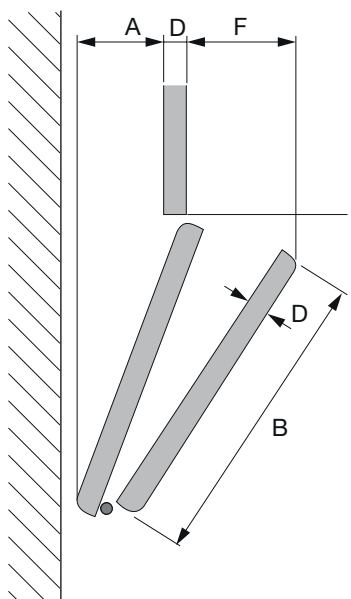


Vplyv závesov na boku korpusu bez obmedzovača uhla otvorenia

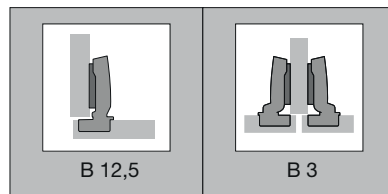

Sensys
8645i / 8675
(efektívny uhol
otvorenia
= 100°)

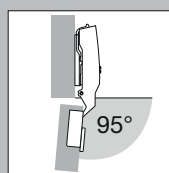

Sensys
8631i / 8631 *

D	B	B 12,5		B 3	
		A	F	A	F
16	250	31	58	21	68
	300	41	58	32	68
	450	73	58	63	68
	600	104	58	4 9	68
18 / 19	250	31	61	21	71
	300	41	61	32	71
	450	73	61	63	71
	600	104	61	94	71
22	250	31	64	21	74
	300	41	64	32	74
	450	73	64	63	74
	600	104	64	4 9	74
25	250	31	67	21	77
	300	41	67	32	77
	450	73	67	63	77
	600	104	67	4 9	77
16	250	13	70	4	79
	300	18	72	8	82
	450	31	78	21	87
	600	44	82	34	91
18 / 19	250	13	73	4	82
	300	18	75	8	84
	450	31	81	21	90
	600	44	84	34	94
22	250	13	74	4	85
	300	18	78	8	87
	450	31	84	21	93
	600	44	87	34	97
25	250	13	78	4	88
	300	18	81	8	90
	450	31	86	21	96
	600	44	90	34	100

* Redukcia uhla otvorenia na 95° dôjde na obmedzenie tlmeneho otvorenia.